## 20000830 094

## Micro-Macro Behavior near the Crack Tip in a Particulate Composite Material

C.T.Liu
Air force Research Laboratory
AFRL/PRSM
10 E. Saturn Blvd.
Edwards AFB CA 93524-7680

In recent years, a considerable amount of work has been done in studying crack growth behavior in highly filled polymeric materials [1-4]. The importance of these studies stems from the fact that the crack growth behavior in the material may significantly affect the integrity of the structure made of that material. The basic used in characterizing approach particulate composite material is based on linear elastic or linear viscoelastic fracture mechanics. According to the theories, crack growth behavior is controlled by the local stress/strain near the crack tip. Therefore, the values of local stress/strain near the crack tip must be determined.

When crack occurs, the high stress at the crack tip will induce high damage near the crack tip region. The high damage zone at the crack tip is defined as the failure process zone, which is a key parameter in mechanics. fracture viscoelastic Experimental data reveal that when the local strain reaches a critical value, small voids are generated in the failure process zone. Due to the random nature of first void is not microstructure, the necessarily formed in the immediate neighborhood of the crack tip. formation of the voids is not restricted to the surface of the specimen where the maximum normal strain occurs. Since the tendency of the filler particle to separate from the binder under a triaxial loading condition is high, it is expected that voids or damage zones will be generated in the

specimen's interior. Consequently, there are a large number of strands, which separate the voids and are essentially made of the binder material, that form inside the failure process zone (Fig.1). These damage processes are time-dependent and are the main factor responsible for the time-sensitivity of strength degradation as well as fracture behavior of the material.

In addition to the damage analysis, the strain fields within a 1.5 mm region near the crack tip were determined using a digital image correlation technique. Experimental findings reveal that the heterogeneity of the microstructure plays a key role in the local damage and strain distribution near the crack tip (Figure 2). Figure 2 shows that the strain fields are highly inhomogeneous and that the high strain regions are localized in the neighborhood of the crack tip. Depending on the location of the high strain regions, voids may develop in these regions and coalesce with the crack tip, resulting in The crack-void growth of the crack. interaction is a contributing factor to the fluctuation of crack growth behavior in this material. Experimental results also reveal that local strain rates are significantly higher than the applied strain rate and that these high strain rate regions are localized to a distance within a 1 mm region of the crack

In conclusion, the heterogeneity of the microstructure plays a key role for local damage and strain distributions near the crack tip. Experimental results indicate that the high strain field is localized within 1 mm of the crack tip. Also, the time - dependent damage initiation and evolution processes are contributing factors to the nonsteady crack growth in this material.

## References

- (1) Liu, C.T. and Smith, C.W.,"Near Tip Behavior in a Particulate Composite Material- An Experimental and Analytical Investigation," Proc. Of 2<sup>nd</sup> International Conf. on Computational Engineering Science, Aug. 1991
- (2) Smith, C.W. and Liu, C.T. Effects of Near-Tip Behavior of Particulate Composites on Classical Concepts," Journal of Composite Engineering, Vol 1, No 4,1991
- (3) Liu, C.T. and Ravi-Chandar, K.," Local Fracture and Crack Growth Behavior in a Particulate Composite Material," Journal of reinforced Plastics and Composites, Vol.15/No.2 1996.
- (4) Liu, C.T.," The Effect of Micro Damage on Time-Dependent Crack Growth in a Composite Solid Propellant," Journal of Mechanics of Time Dependent Materials, Vol.1 1997..

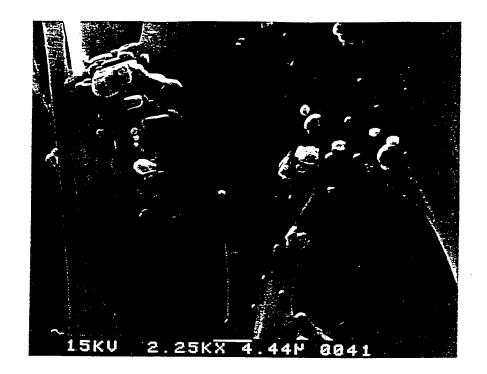


Figure 1. Damage zone at crack tip.

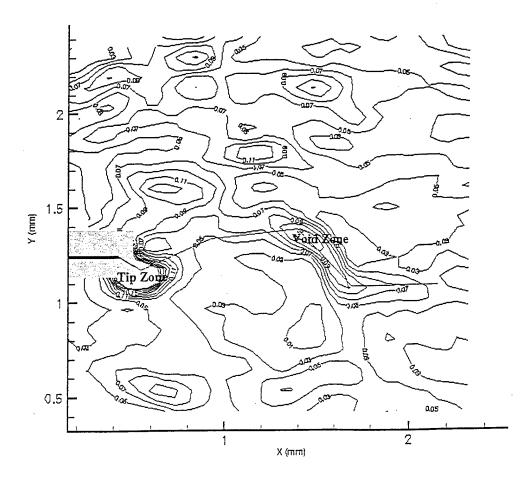


Figure 2. Maximum principal strain distribution at 6% applied strain.